


## TO READ .01" EXTENDED RANGE OUTSIDE DIAMETER TAPES

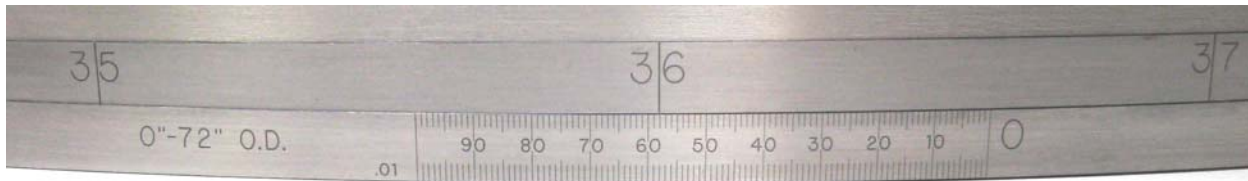

**Make certain the tape is free of damage and the tape and object to be measured are both clean.**

**Each line on the gage member represents 1.00", while each line on the vernier represents .01".**

**Wrap the tape around the object to be measured. The vernier scale should be just below the gauge scale. Tighten the tape around the object with 5 pounds tension for O.D. tapes.**

**Locate the "zero" on the vernier scale and note the highest value achieved on the gage scale above it (the highest value to the left of the zero). In this example, that value is 36.00".**

**Next, observe the vernier scale's value at the point where it lines up closest to the marked division line on the gauge scale. In this example, that value is 58 (.58").**

**Finally, to obtain the diameter of the object, simply add the two values together:  
 $36.00" + .58" = 36.58"$**

**When reading the O.D. tape, make certain to apply a snug pull of 5 pounds tension, first making sure the tape and part have been properly cleaned.**

**As a suggestion for checking very large diameters – pieces of masking tape can be used to hold the tape in the proper parallel position.**

**These tapes are guaranteed to +/- .01" accuracy on tapes up to 144".**

### **Care**

**When not in use, wipe clean and apply a light rust preventive oil. Store in tape container.**

**No periodic adjustments are needed.**

**Make sure the tape has not been stepped on or kinked, which may destroy the accuracy.**